


Accessories for TESA FMS Probes

Spring set for the measuring force

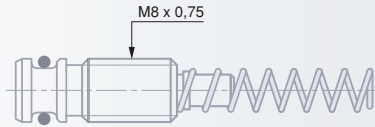

Spring set for the measuring force

Examples A to C
Item 5



	N	
*	2,0	nickel-plated
03260448	0,4	red
03260449	0,63	yellow
03260450	1,0	green
03260451	1,6	blue
03260452	2,5	brown
03260453	4,0	black

* Provided with FMS probes



All values given in the table for the measuring force equal nominal values at electrical zero; max. deviation $\pm 25\%$. Valid for probing movements exerted horizontally as well as in static measuring.



Accessories for Pneumatic Activation of the Mobile Probe Body



03260440

Pneumatic jack



Operates the mobile probe body. Force under a pressure of 4 bars = 11 N
Examples B and C
Item 8

Auxiliary spring-loaded element

Example C
Item 10



	N	
03260441	0,4	red
03260442	0,63	yellow
03260443	1,0	green
03260444	1,6	blue
03260445	2,0	nickel-plated
03260446	2,5	brown
03260447	4,0	black

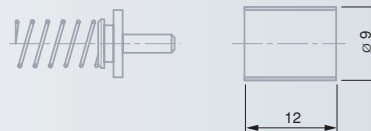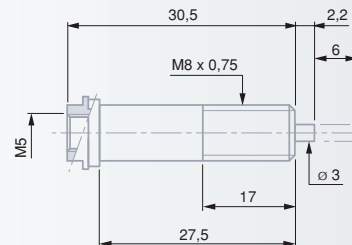

Probe Insert Holder with Fine Adjustment

Helps you to set the probe – Setting and locking screws remain accessible even when several probes are mounted side by side.



Width of the insert holder. 12 mm



Mounting bores for probe inserts



	mm	Number	Position	mm
02630053	4	2	horizontal	25
02630055	4	1	vertical	25
02630052	6	2	horizontal	25
02630054	6	1	vertical	25

